

# Jordan Transformer Mobile Project


7.5 MVA FOA 69000 x 34500 – 7200/12470Y/7200 x 2400/4160Y/2400 GE



DGAs showed 128 PPM Acetylene



Transformer was gassing 1 PPM acetylene each day in service

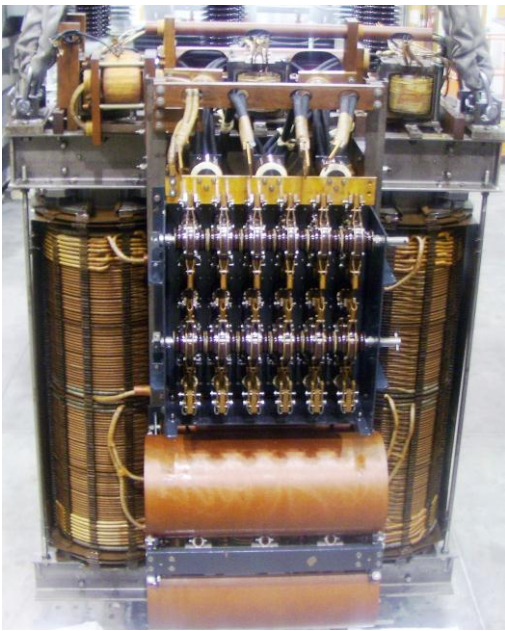

Core & Coils tested as "good"



Transformer & trailer was sandblasted, painted, re-gasketed, and DOT inspected

The oil pump motor was failing & generating the acetylene. The pump was remanufactured. The core & coils were dried out and reused. Entire mobile was reconditioned and load tested to confirm the diagnosis.



